

PH: 405-340-3434 FAX: 405-340-3435 Edmond, OK 73013 WWW.pelcoinc.com

This drawing is the property of Pelco and is not to be used in whole or in part without Pelco's written permission.

## ASSEMBLY CUT SHEET

F: TI


Cable Retainer Assy for 4" Foundation Anchor, 10" Plate w/ 8"-10" BC, Steel

PART NO.:

SP-6405

Example Part No. SP-6405-GLV

Galvanized-

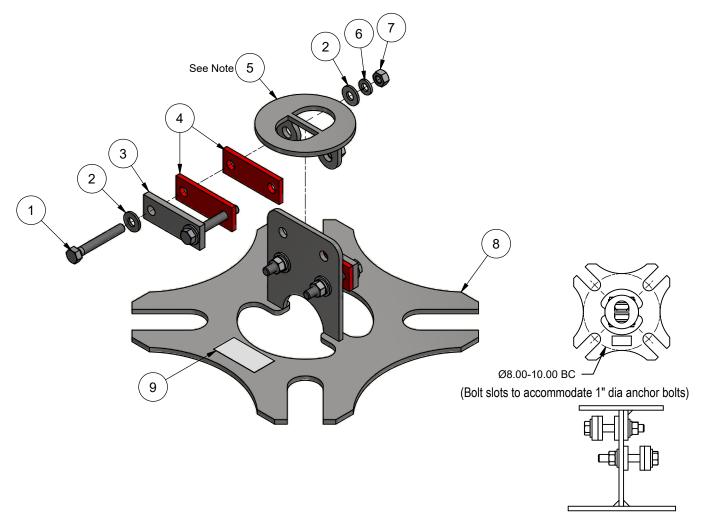

Note: First saddle #5 Conductor Guide onto #8 Cable Retainer Weldment before assembling #3 bar & #4 Pads

Side View (See Note)

ITEM	PART NUMBER	DESCRIPTION	QTY
1	FS-2016-SS	Bolt, Hex Hd Tap, 5/16"-18 x 2-1/4" , Type 304 Stainless	4
2	FS-4101-SS	Washer, Flat, 5/16" x 3/4" OD, Type 304 Stainless	8
3	SP-6199-3-GLV	Bar, Cable Retainer Assembly, Steel	2
4	SP-6199-4	Pad, Cable Retainer, 1/4" Thick, 40 Durometer, Red Urethane	4
5	SP-6251-GLV	Weldment, Conductor Guide, for 4" Cable Retainer Assy, Steel, Galv	1
6	FS-4201-SS	Lock Washer, Split, 5/16", Type 304 Stainless	4
7	FS-1001-SS	Nut, Hex 5/16"-18, Type 304 Stainless	4
8	SP-6404-GLV	Weldment, Cable Retainer for 4" Foundation Anchor, 10" Plate w/ 8"-10" BC, Steel	1
		Galv	
9	O-3212	Label, 1" x 2", Product Part Number	1
	Z-2057	Instructions, Cable Retainer Assembly SP-6200	1
TKM DRAWN:	3/25/2021 JSH DATE: CHECKED:	3/29/2021 KAK 3/29/2021 RKV 3/29/2021 DATE: MFG ENG: DATE: QA: DATE: REV: DATE: REV CHKID: DATE: SH	EET 1 OF 1

